

## ***VX-160EV/180EV Final FET upgrade modification***


Please apply following a temporally upgrade modification when you will have servicing to replace fault FET with **VX-160EV/180EV** for production lot between #25 and #44. After #45 all modification applied to production.

<NOTE> DON NOT make transmit VX-160EV/180EV without antenna or dummy load connection.

We would like to recommend that it should be better replacing FET, if you will have to apply this upgrade to current customer using VX-160EV/180EV radio.

**1) Remove thermal sheet (RA0533600) form chassis**

**2) Put Silicon grease as follows**

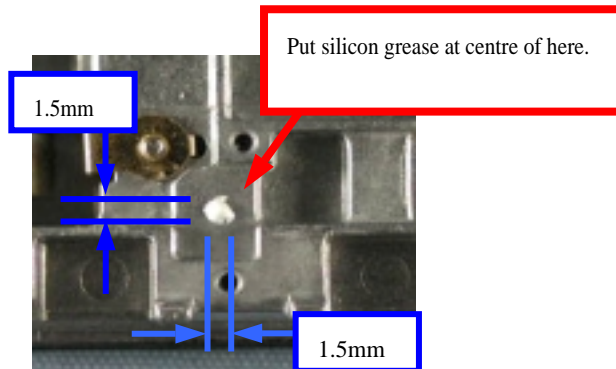


**3) Put heat sink plate**

Please make sure radio production lot number as following two heat sink plates.

Production lot # 45 and after should be applied RA0727570.

For # 25 to # 44: Please use heat sink plate as (RA0730600)

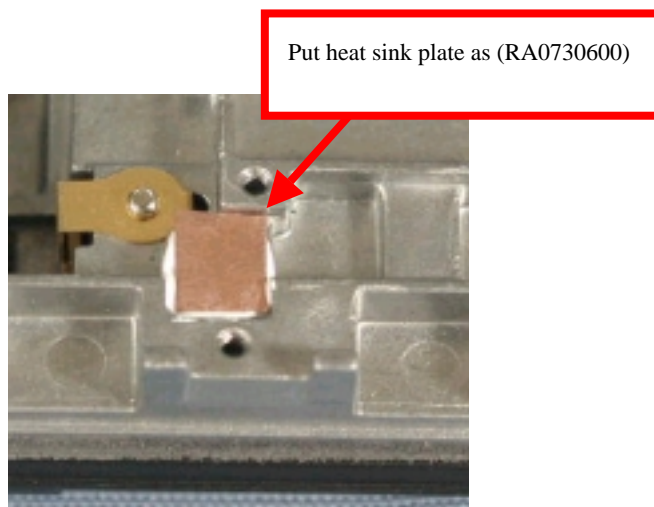

4) Put silicon grease as two places like this

